Management Options for Improving Flows of the Shoalhaven River at Shoalhaven Heads

19

November 2015

By W

Project Details

Report Title	Management Options for Improving Flows of the Shoalhaven River at Shoalhaven Heads
Report Author(s)	W C Glamore, J E Ruprecht and D S Rayner

1. Introduction

The Shoalhaven River entrance at Shoalhaven Heads (Figure 1.1) has been an area of considerable interest and debate for many years. The creation of Berrys Canal provided a direct link between the Shoalhaven River and Crookhaven Heads. Since then erosion and dredging has expanded the canal and it

2. Background Information

The evolving nature of the entrance at Shoalhaven Heads has been an ongoing issue for the local Shoalhaven community for many decades. News articles dating back to 1936 (Shoalhaven News and South Coast Districts Advertiser, 1936) indicate that the local community (then known as µerry Bailey ¶) wished to have the

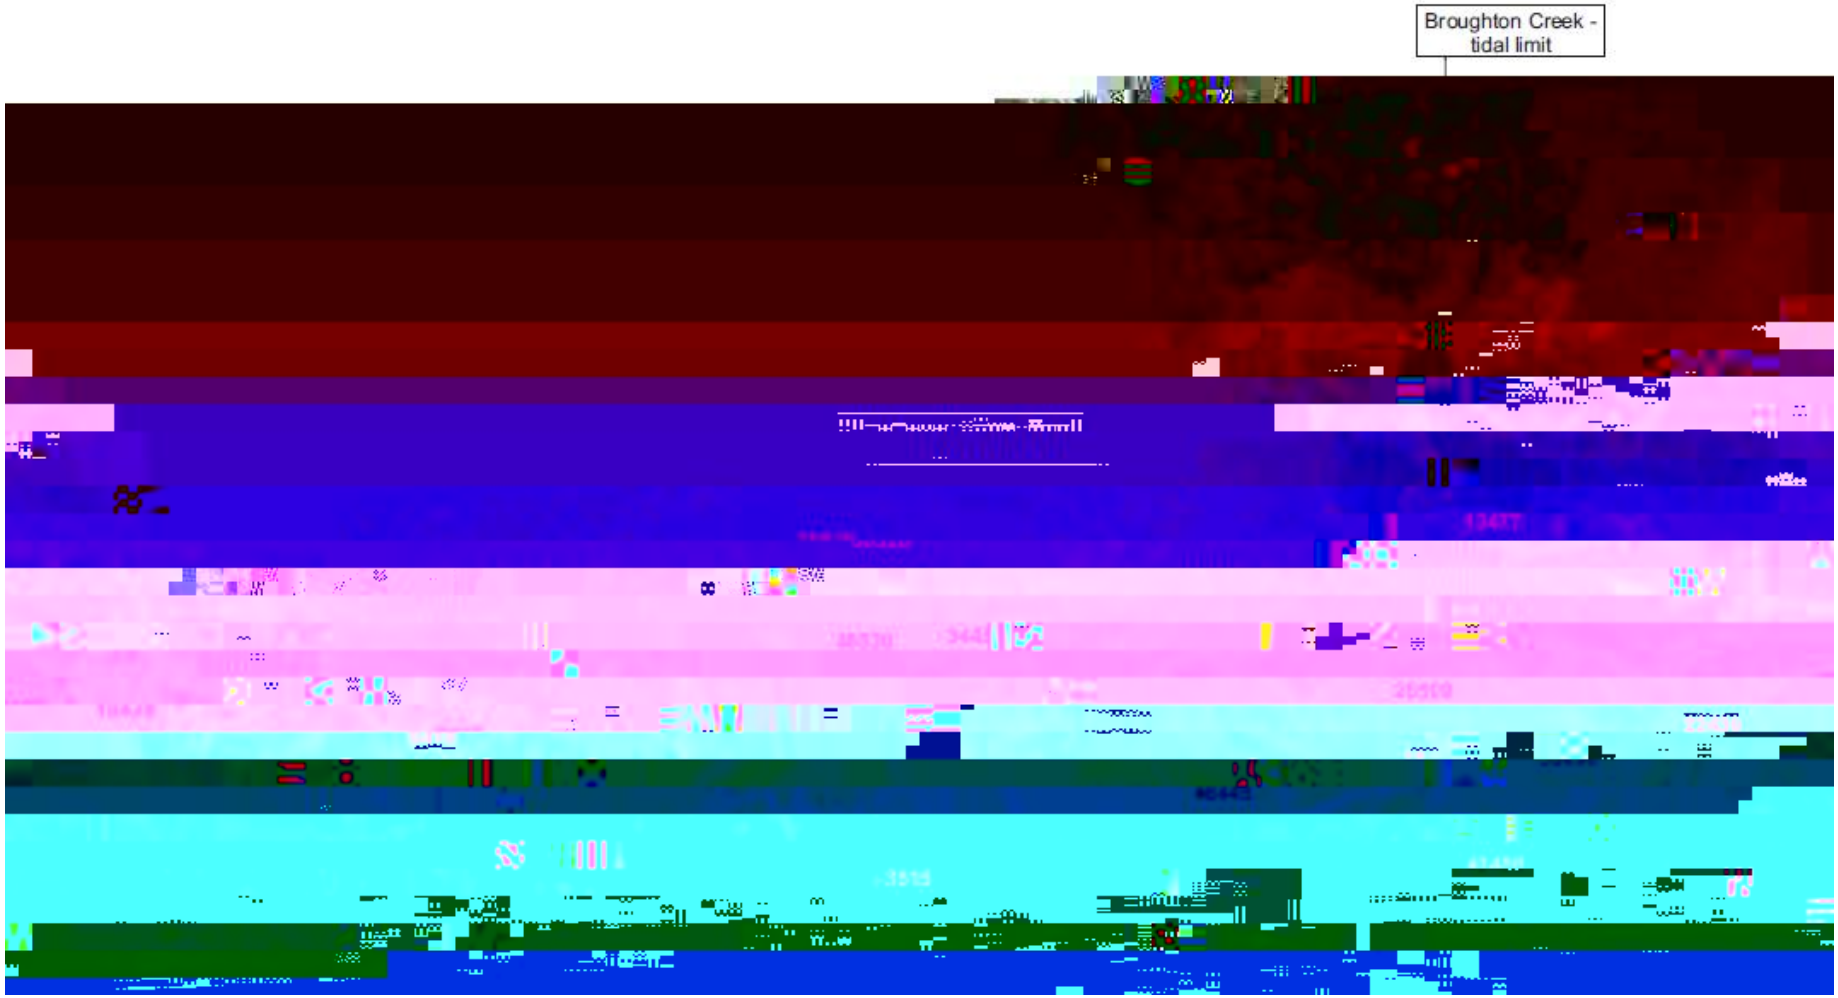

Figure 2.1 Shoalhaven River Estuary (with chainage from Crookhaven River mouth) as per Miller et al. 2006

make informed choices about ecological, social and commercial goals for the river. The report U H F R P P H Q G H G ? integrated management of the estuarine waterway, its interaction with ocean processes and its interaction with land uses and processes operatin g on the floodplain ´ Various actions were identified to better integrate water quality concerns across the floodplain, including add ressing acid sulphate soil drainage in the lower estuary.

The HRC (1999) also detailed the considerations of the commu>> BDCi93of and thes7(H)4me7(d)-3(e)ce6(e)30(ass)4(s)

plan does provide a review of environment factors (REF) prepared in accordance with the requirements of the Environmental Planning and Assessment Act (1979). The REF (SCC, 2009) assesses the impacts of artificially opening the river and of maintaining the dry notch. The REF and plan

providing training on the important estua rine/coastal processes. A picture of the demonstration model is provided in Figure 3.3 .

- Finally, various other models were provided to engage with the local community. This included a physical wave model that highlighted the role of waves in f(w)5(.*5J ET BT 1 0 0 1 321.79 44

Figure 3.3 Display of the Shoalhaven River Estuary Model

3.2 Community Science Survey Results

A ten (10) question survey was distributed to attendees during the Community Science Day. A copy of the survey is provided in Appendix A. The aim of the survey was to better understand the interests, desires and background knowledge of the local community. The results of the survey are provided in Figures 3.4 - 3.15 below.

Results from the 111 surveys completed can be summarised as follows:

Figure 3.8 Importance of Environmental Value(%)] TJ E595.f* q 3.6 500.4 446.04 263

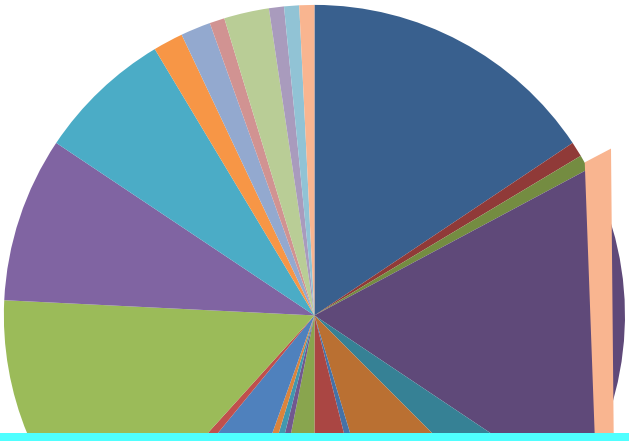

Figure 3.10 Most Common Activity in the Shoalhaven River Estuary

Figure 3.11 General Understae

Figure 3.12 Importance of Maintaining Existing Environment and Amenity in Estuary

Figure 3.13 Importance t

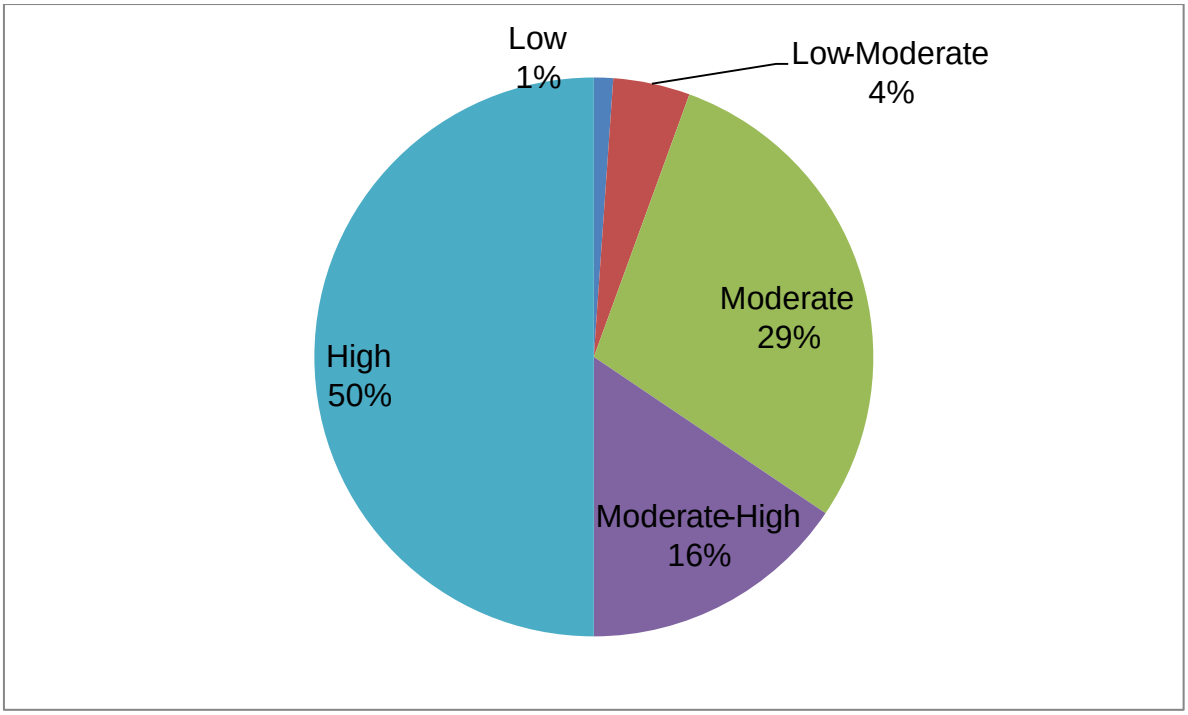

Figure 3.14 Interest in Environmental Training and Education

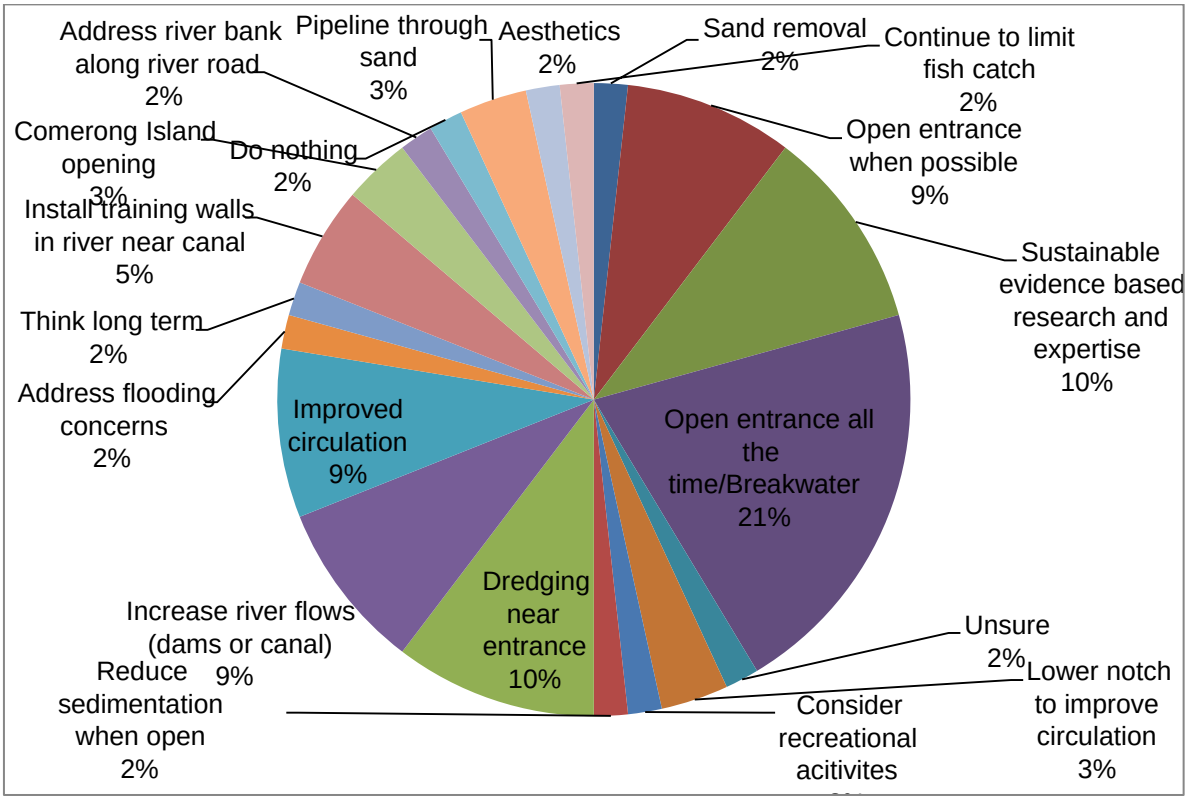

Figure 3.15 Future Management Actions

Survey results were used to focus the options addressed within the study. An assessment of the options assessed is detailed in Section 5.

3.3 State Agency Positions on Shoalhaven Heads Entrance

As part of this study, various state agencies were contacted and a request lodged to update their positions on the Shoalhaven Heads entrance. The NSW Department of Primary Industries – Fisheries (DPI Fisheries), the NSW Office of Environment and Heritage (OEH) and the NSW Crown Lands Department (Crown Lands).

Position statements were previously noted within

consultation. The process followed by Council so far is in line with 2(+¶V SRVLWLRQ Any amendment to the existing policy will need to follow a similar process.

,Q VXPPDU\ 2(+¶V updated response states WKDW management options were thoroughly considered through the Estuary and Floodplain Management Planning process and the resultant plans are an appropriate guide for management decisions ¶ The response also states that µam not aware of information that identifies a significant threat to public health or water quality deterioration in the lower Shoalhaven River estuary. To the contrary, completed estuary health report cards by Shoalhaven City Council undertaken with financial and technical assistance from WKH 2(+ LQGLFDWH WKH 6KRDOKDYHQ 5LYHU¶V HVWXDU\ KHDOWK LV JRRG

Figure 4.1 EcoHealth Risk Assessment Report Card (after SCC, 2011)

Water quality monitoring results are also available via the Aquadata website operated by SCC (http://webreports.esdat.net/SCC). Data reports available within the vicinity of the Shoalhaven Heads are limited to two sites namely, the River Road Reserve Boat Ramp and the Hay Avenue %RDW 5DPS DW WKH PRXWK RI %HUU\¶V %D\ 7KH DYDLODEOH GDWD YD many of the parameters have not been reported beyond 2013. Available parameters within the Aqua Data database include:

- Temperature
- Dissolved Oxygen
- Faecal Coliforms
- Total Suspended Solids
- Enterococci
- pH
- Phosphorus
- Nitrogen (total, total oxidised, Kjeldahl Nitrogen, Ammonia)
- Salinity/Electrical Conductivity

Figure 4.2 Salinity Concentrations within Shoalhaven River Estuary

From an ecological perspective the salinity conditions experienced are within natural fluctuations. There are no salinity triggers or guidelines for estuaries and therefore no determination as to whether an exceedance value is triggered by altering salinity. However, for oyster harvest areas salinity is an important variable.

As per the NSW Food Authority, there are six (6) areas in the Shoalhaven River estuary for harvesting of oysters (Figure 4.3) %HUU\¶V %D\ DQG :HVW DQG 3XPL within the Shoalhaven Heads region with the other areas located further downstream. The Australian Shellfish Quality $VVXUDQFH 3URJUDP FODVVLILHV %HUU\¶V %D\ DV µ&RQGLWLRQDOO\ 5HV some local issues with water quality, but at levels low enough to be removed via depuration. 7KH FRQGLWLRQV IRU WKH %HUU\¶V %D\ VLWH DUH EDVHG RQ UDLQIDOO and salinity (less than 18 ppt or approximately 30,000 uS/cm).

Figure 4.2 indicates that salinity is often below 30,000 uS/cm following rainfall. Salinity conditions at Crookhaven Heads also fall below this trigger value but recover quicker. Indeed, the only time when salinity concentrations are higher at Shoalhaven Heads versus Crookhaven Heads is when the entrance was opened following a manual entrance opening in early 2013. As VXFK WKH RVWHU LQGXVWU\ DV VXFK LV QRW GLUHFWO\ DIIHFWHG E\ WKH RSHQLQJ RI WKH HQWUDQFH DW 6KRDOKDYHQ Heads as it ensures elevated salinity concentrations and a quicker return to salinity concentrations above 30,000 uS/cm after rainfall (pers comm, J. Zealand).

4.1.2 Dissolved Oxygen

Dissolved oxygen (in % saturation)

% saturation and 87 % saturation, respectively. Numerous measurements below 80% saturation appear to coincide with catchment wide rainfall events when nutrien ts or low -4(d)34 75ssolved oxygen inflows can be -4(d)34 75scharged into the system.

Low -4(d)34 75ssolved oxygen measurements in the lower Shoalhaven River estuary have been previously linked to acid sulphate soil -4(d)34 75scharges from acted floodplain -4(d)rainages. Glamore (20 14) and Glamore et al . U H F R U G H G V L J Q L I L F D Q W µ E O D F N with Z D W H U ¶ C corresponding low -4(d)34 75ssolved oxygen concentrations , -4(d)34 75scharg34 7(n)6(g)-3( )-327(i)-5(n)6(t)-5(o)-5( )-327(B agr34 7(cu)7(l)-5(t)-5(u)6(ral)-4( )-74(-4(d)ra)15(i)-5(n)6(s)] TJ ET BT 1 0 0 1 173.42 648.82 Tm [( )] TJ ET BT 1 0 0 1 177.2 oxygen leveds can occur -4(d)ue to -4(d)34 75ssolved oxygen consumption fro iron react4(d)34 75ons or -4(d)ue to oxygen consumption froprolonged inundation of floodpdain vedetation. This water can then be -4(d)34 75scharged ownstream with the tide and transported into the Shoalhaven Heads redion. S34 75milar events have been noted throughout acid sulfate soil estuaries in NSW inclu-4(d)34 75ng the Hunter River, Richmond River, Widson River, Clarence R34 75ver, Macleay River and Man4 75n34 75ng Estuaries .

Figure 4.3 Harvest Areas in the Shoalhaven River (from Shoalhaven River Oysters, 2012)

Figure 4.4 Dissolved Oxygen Conditions at the River Road Reserve Boat Ramp (a), Hay Avenue (b) an

Faecal coliform counts within the vicinity of Shoalhaven Heads are shown to be typically within acceptable levels with individual measurements occasionally exceeding triggers values. As noted in the guidelines, individual readings may exceed the trigger but subsequent samples (4 out of 5) at the River Road Reserve Boat Ramp and Hay Avenue return below trigger concentrations. Generally, faecal coliform triggers are exceeded at Hay Avenue more frequently than at the River Road Reserve site suggesting the source is further upstream. However, the source is difficult to ascertain as occasional high measurements in estuaries can be associated with septic tank discharges, stormwater overflows or agricultural runoff (faecal coliform counts do not distinguish between human and other warm blooded sources e.g. cattle).

Additional data collected by Food Safe Authority (2013) suggests that faecal coliform counts are KLJKHVW ZLWKLQ WKH XSVWUHDP UHDFKHV RI 4.8% exceedance of trigger values in $V SHU)LJX exceedance of the trigger values were measured during multiple sampling runs between 2004 and 2013. This suggests that a source of faecal coliform contamination may be evident within %HUU\¶V %D\ DQG IXUWKHU VWXGLHV DUH UHFRPPHQGHG

4.1.4 Water Quality Summary

Based on the limited data set

Figure 4.6 Stage - Volume Relationship for Shoalhaven Heads area (denoted in red)

In addition to tidally driven circulation, wind forced circulation would play an important role in the Shoalhaven Heads embayment area. Predominant northeast winds in the summer and southeast winds in the winter have sufficiently long fetches in the embayment to drive water circulation fostering water turnover and decreasing any vertical stratification caused by solar radiation. This additional wind driven circulation would increase mixing and overall circulation in the embayment

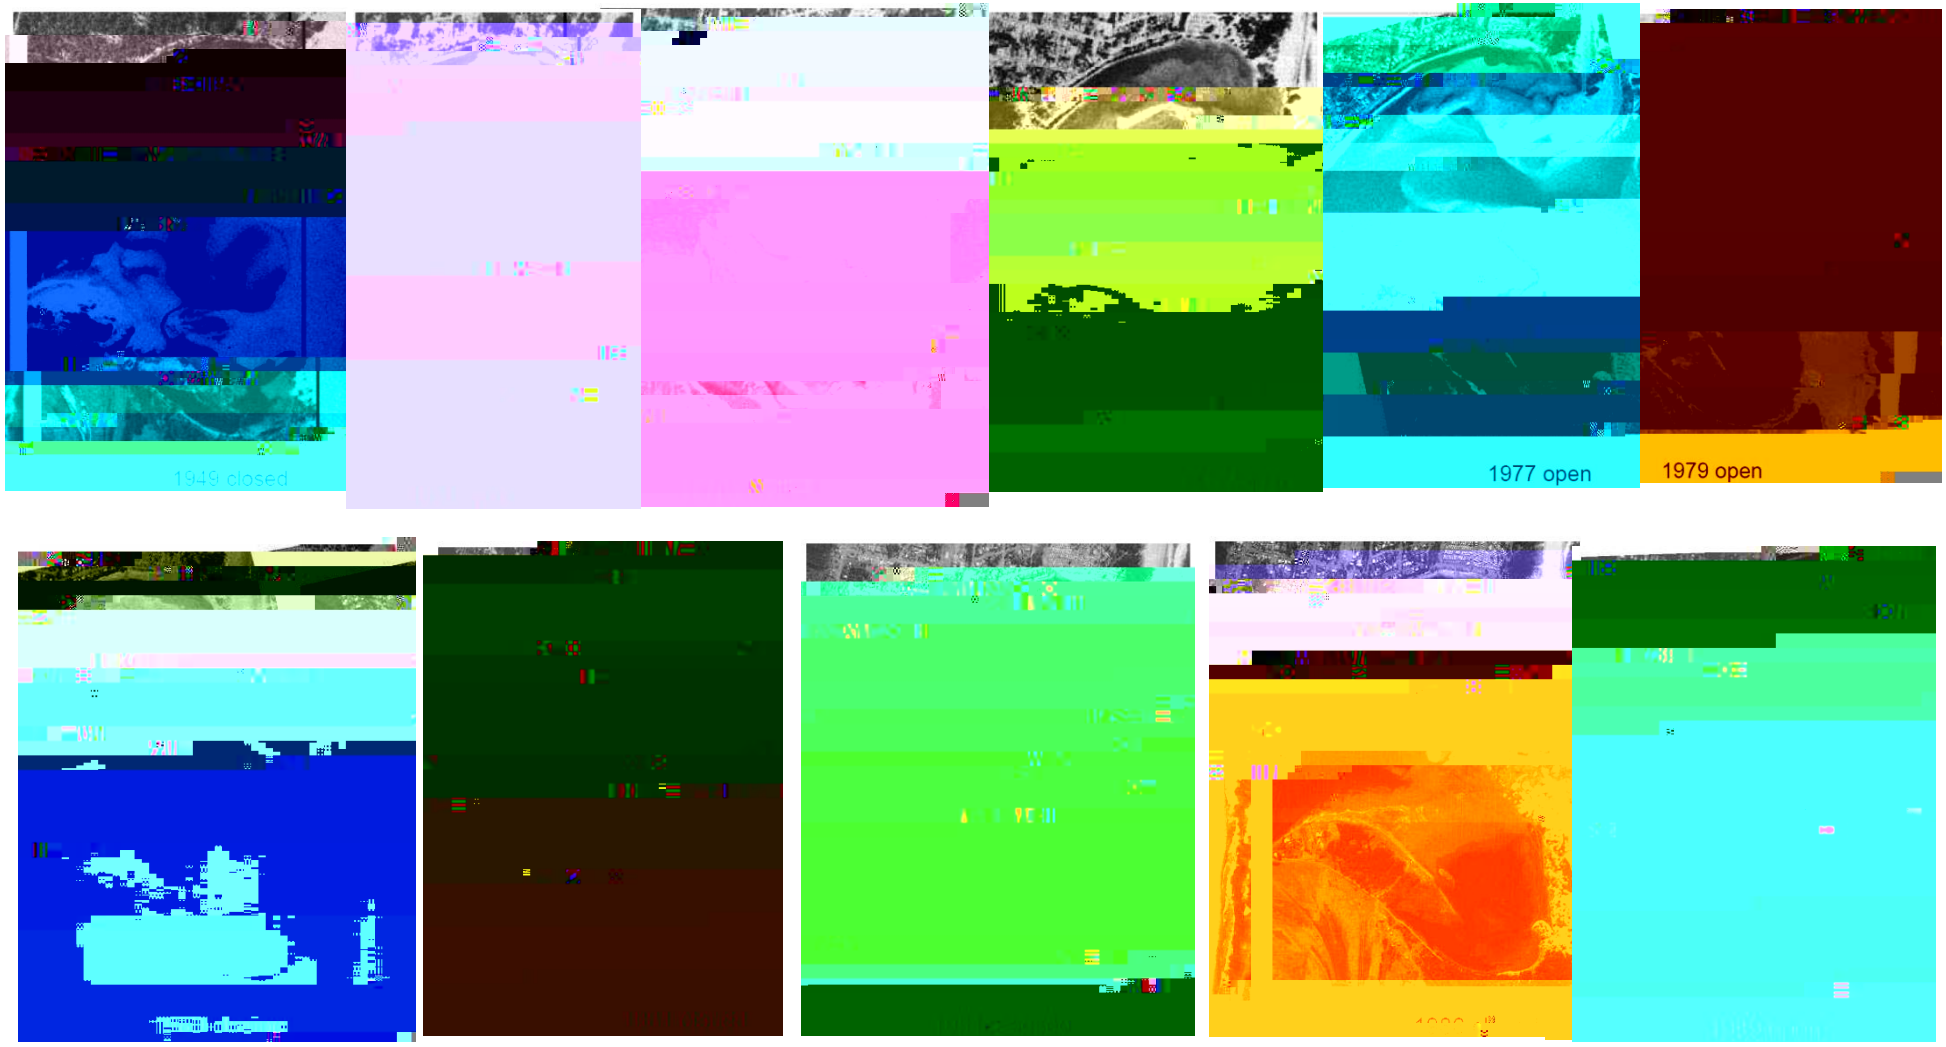
1949 closed
1977 open
1979 open

Figure 4.8 Historic Aerial Images of Shoalhaven Heads (1991 - 2015)

The formation of a flood tide delta is evident in several of the historic aerial images. Depending on the entrance dynamics and the antecedent conditions, the flood tide delta can lead to significant volumes of sand being deposited within the bay. Large sand deposits are apparent in the aerial imagery from 1949, 1981, 1996, 2005 and 2015. However, in subsequent images the sand deposits have been removed from the estuary by the preceding flood event.

Additional information comparing bathymetry profiles against recent data should be available upon completion of this study (pers comm, R. Caravalho). It is recommended that this information is reviewed to determine areas with enhanced sedimentation rates. Following recent floods in August 2015, surveys were also undertaken of the area immediately seaward of the entrance. This information should also be assessed to quantify settlement zones and bar formation as well as available sediment for re-entrainment.

The other significant item worth noting in the aerial imagery is the extent of the dune

Table 4.1 Historic Flood Events on the Shoalhaven River Estuary (adopted from SCC, 2006)

Month and Year of Flood	Estimated Flood Height at Nowra (m AHD)	Month and Year of Flood	Est imated Flood Height at Nowra (m AHD)
February 1860	5.7	June 1949	4.0
June 1864	5.2	February 1956	4.6
April 1867	5.0		

pro posed dredging and model - tested to determine if subsequent improv ements to circulation in this area hav e the potential to increase local water quality.

A description of the results for each option is provided below.

5.1 Decreas ed Cross - Sectional Area of Ber U \ ¶ V & D Q D O

Numerical simulations were undertaken using a 2 - Dimensional hydrodynamic computer model of the lower Shoalhaven River estuary to test the influence of decreasing the cross - sectional area RI %HUU\¶V &DQDO RQ WLGDO IOXVKLQJ The model was previously calibrated as per Miller et al. (2006) and Glamore et al. (2014). T he model was used to simulate existing conditions including ZDWHU OHYHOV YHORFLWLHV DQG WLGDO IOXVKLQJ G\QDPLFV 5HVXOW depicting resident flush ing times during base flow conditions, are provided in Figure 5.1 . These tests were undertaken with a conservative (i.e. no decay) tracer concentration of 100 arbitary units initially distributed across the entire estuary. The oceanic boundary concentrati on was set to 0 arbitrary units. In this manner , tidal (i.e. oceanic) flushing rates (in percentages) could be quickly calculated.

The results from the baseline model simulations provide an indication of the existing tidal flushing throughout the estua ry. Figure 5.1 shows that after 2 days of tidal flushing the Shoalhaven Heads region is unchanged. After 3 days of tidal exchange the area has been 30% flushed and following 8 days of tidal exchange , via Crookhaven Heads , the area is approximately 70% fl ushed. Following 15 days of tidal exchange, the area is shown to be 80% flushed but it requires another nearly 15 days of tidal exchange to reach 90% flushing. These results provide a useful ba seline estimate to compare tidal flushing characteristics und er various engineer ed options .

6LPXODWLRQV ZLWK D GHFUHDVHG FURVV VHFWLRQDO DUHD RI %HUU\¶V Decreased Cross Sectional Area. %HUU\¶V Three alternative scenarios were tested including a 30% reduction in canal cross - sectional area, a 50% reduction in canal cross - sectional area and the construction of a constriction from 2¶.HHIH¶V 3RLQW WR ZDUGV 6KRDOKDYHQ + HDGV Decreased Cross Sectional Area. For these WKH FURV scenarios the model was retested and compared against the baseline scenario to assess tidal flush LQJ G\QDPLFV DQG LPSOLFDWLRQV ZLWKLQ %HUU\¶V &DQDO

The results from the updated modelling scenarios suggest that the reductions in cro ss sectional area have a limited e ffect on tidal flushing in the Shoalhaven Heads area and result in higher velocities ZLWKLQ %HUU\¶V &DQDO Within the restricted canal scenarios the velocities within the canal increased correspondingly to the percent restricted but did not significantly alter tidal flushing within the estuary. For the scenario with a restricted entranc H DW 2¶.HHIH¶V 3RLQW large eddy was formed in the vicinity of the entrance and velocities significantly increased through the entrance , however there was no appreciable effect on circulation within Shoalhaven Heads . Animations of the hydrodynamic resul ts are provided as electronic video files with this report.

The results from this management option suggest that decreasing the cross sectional area of %HUU\¶V &DQDO ZLOO QRW DSSUHFLDEO\ DOWHU FLUFXODWLRQ ZLWKLQ result in increased velocities and subsequent erosion. To this point unless significant and costly erosion control measures were installed , the channel would likely scour to the existing cross - sectional area. A decreased cross sectional area would also have a sig nificant influence on upstream flood levels and would need to be tested in any future flood study assessments.

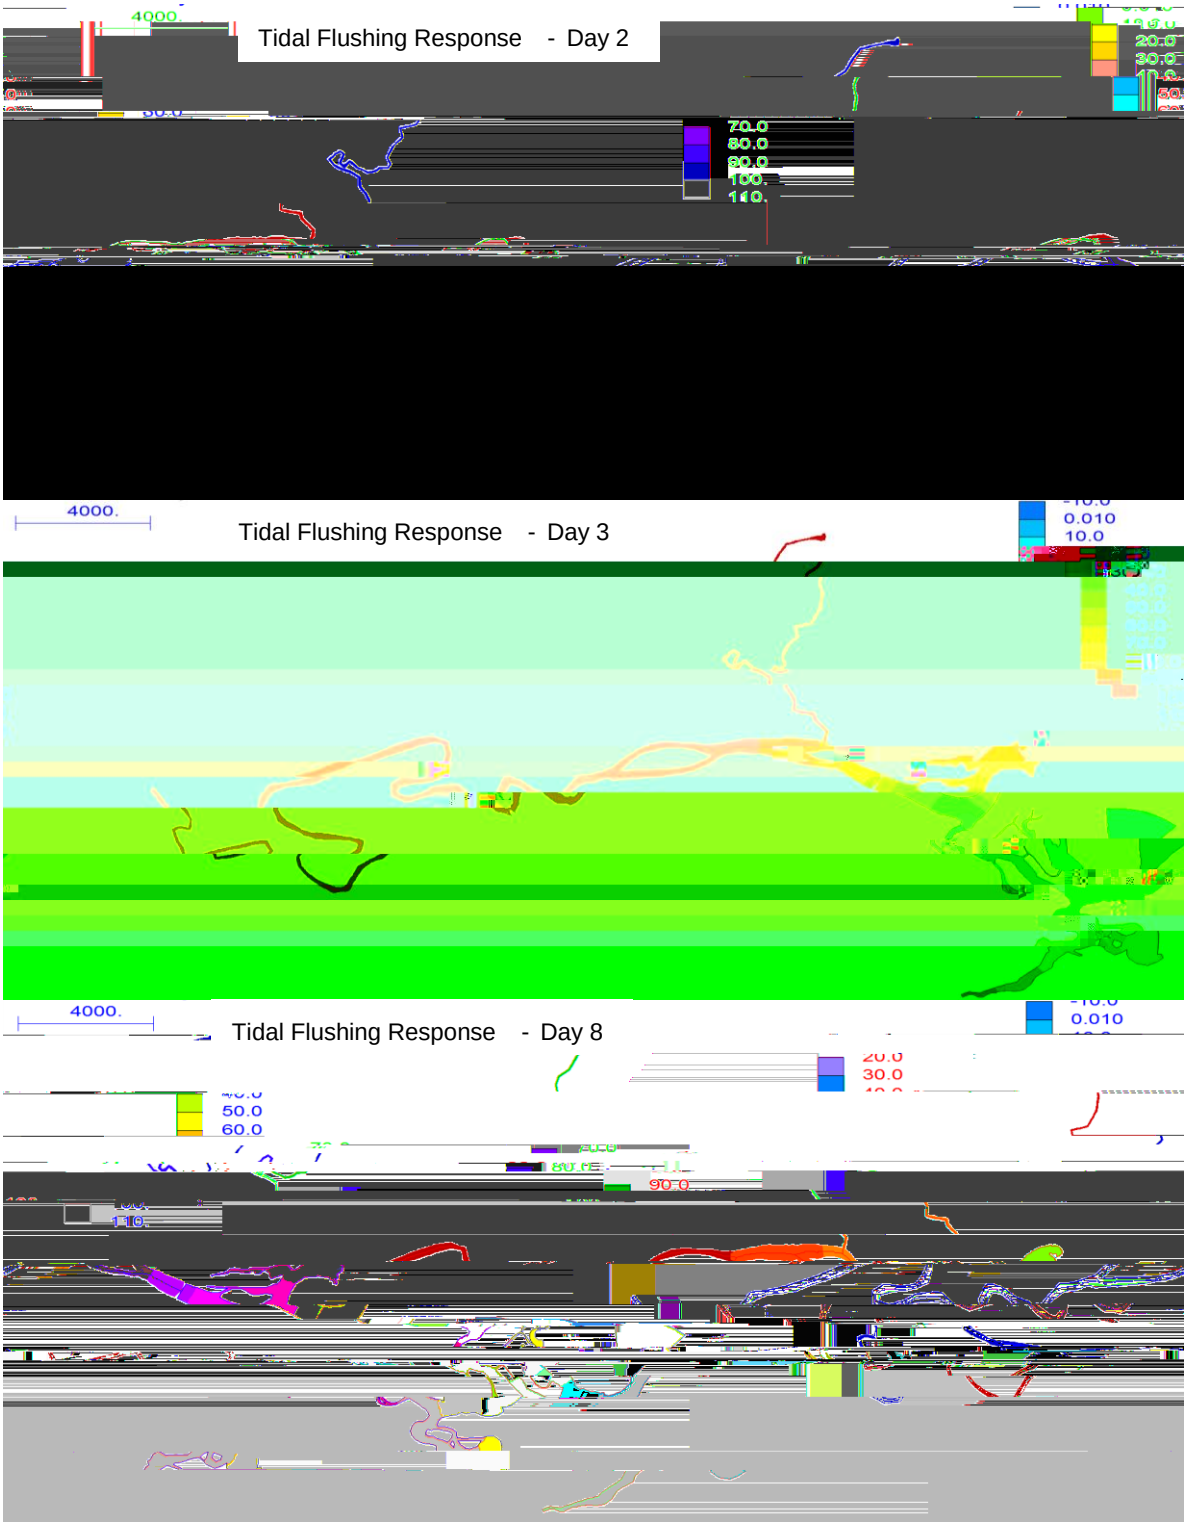

Figure 5.1. Tidal Flushing Results For Baseline Scenarios at 2, 3, 8, 15 and 29 Days

Figure 5.2 F R Q W. ¶ G Tidal Flushing Results For Baseline Scenarios at 2, 3, 8, 15 and 29 Days

5.2 Increased Circulation at Shoalhaven Heads via Oceanic Transfer Pipes

In theory , oceanic pipes could u tilise the tidal lag between Shoalhaven Heads (when the entrance is closed) and the ocean to transfer marine water into the bay and hence, increase circulation. This is particularly appe aling to the community as local feedback suggests that the community desires marine conditions within Shoalhaven Heads (versus the existing estuarine conditions). To test this option, a series of analytical equations for pipe flow were developed using real tidal levels. The tidal signal adopted is illustrated in Figure 5. 2.

The results from the analytical assessment suggest that the transfer pipes would not provide sufficient exchange to influence circulation. Assuming two (2) 0.9 m diameter pipes could be effectively installed to transfer water without excessive marine growth or sediment clogging the pipes , the maximum volume provide d is approximately 8000 m^3. As discussed earlier, the stage - volume relationship for the bay suggests that regular tidal exchange within the system is approximately 1,000,000 m^3

Figure 5.3. Tidal Heights Used to Calculate Potential Tidal Exchange

5.3 Increased Circulation via an Excavated

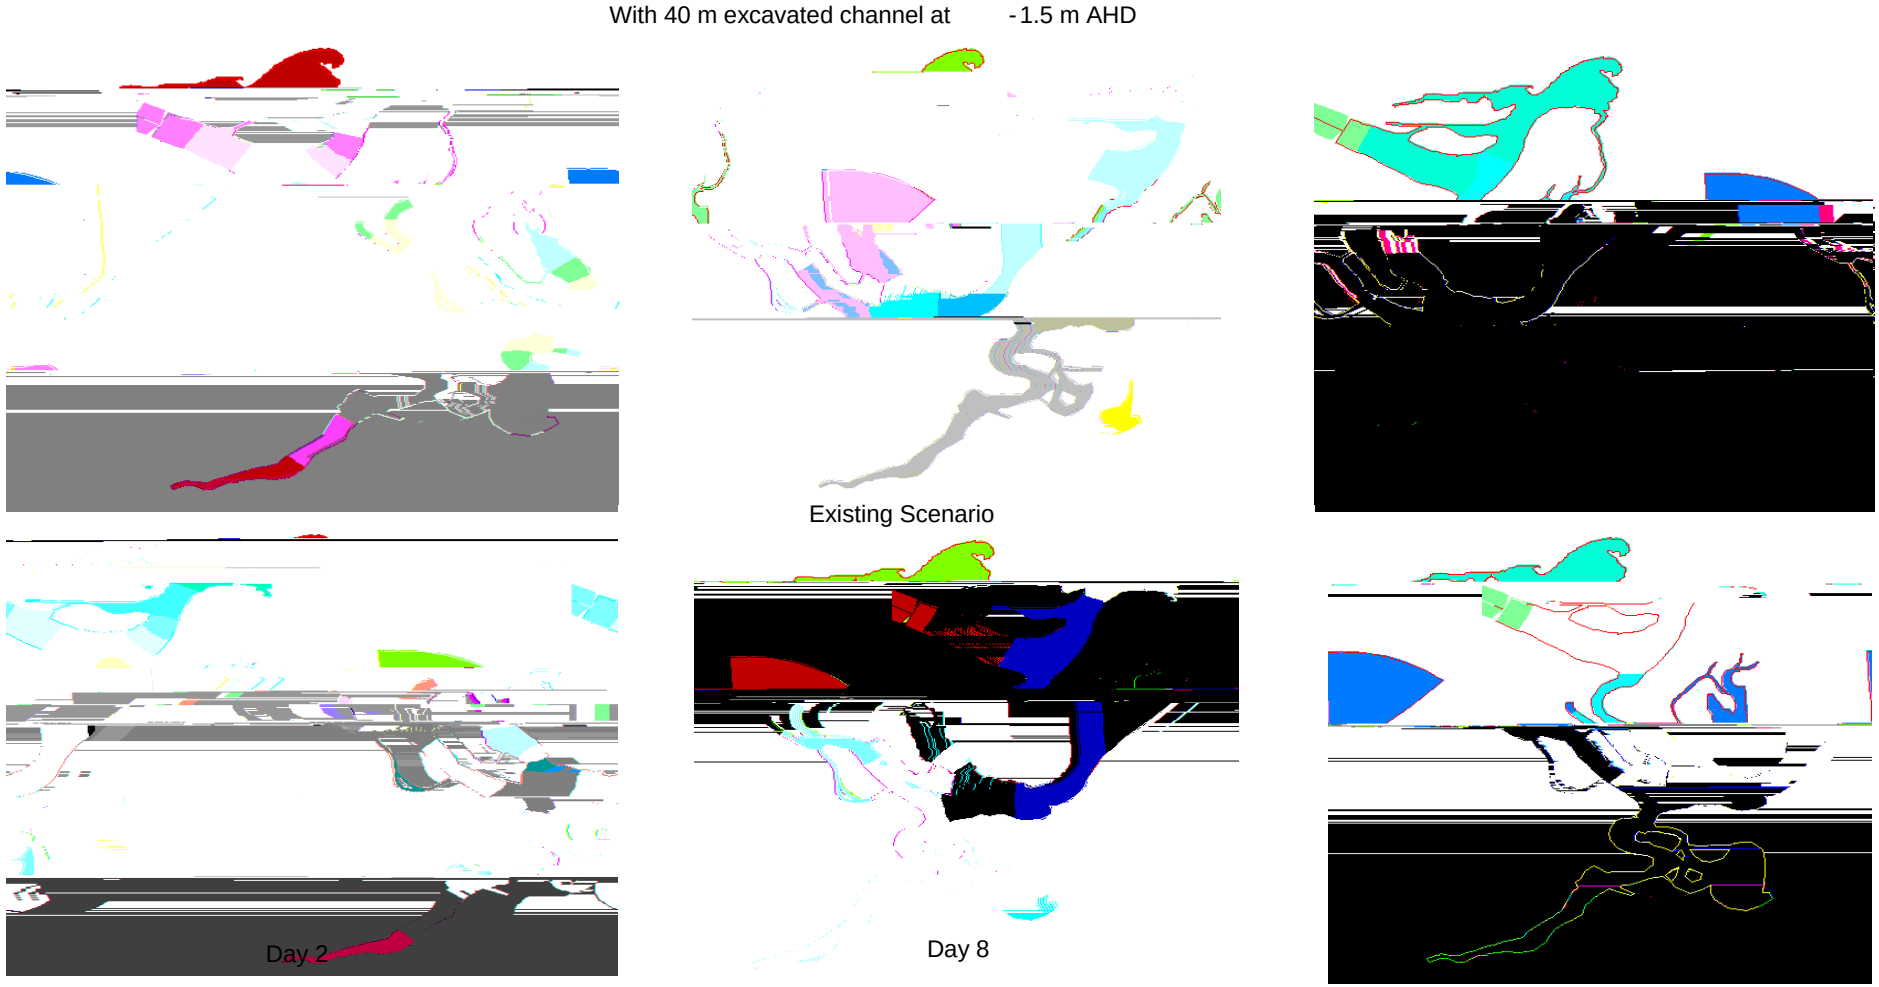

Figure 5.4. Tidal Flushing Simulation Results with (top row) and without (bottom row) a Channel Linking Comerong and Shoalhaven Heads.

5.4 Targeted Dredging Works within Shoalhaven Heads

Due to the extensive flood tidal delta that forms when the entrance is open, entrance dredging and local sand placement has not been extensively modelled for this study. An analysis of a simi

5.5 Assessment of a Permanent Entrance

The primary aim of this option is to examine concept designs for improving circulation within the waterbody adjacent to Shoalhaven Heads. For this assessment the entrances examined by Posford et al (1977) were re-assessed to determine if contemporary techniques would significantly alter methods or designs. As noted in the brief, our review of the entrance options was based on expert professional advice. Significant additional field campaigns and numerical/physical modelling would be necessary to undertake a detailed design of any preferred entrance option.

The preferred option recommended by Posford et al. (1977) is a series of groynes either side of the entrance. This option, as depicted in Figure 5.4, has four (4) pair of groynes with the first pair BT 1 0 fm 0 fm -220(BTm)1m -220(BT-5(n)6( )-20(t7)-5(d)-3(n)6(t)g3(t)-5(h)6(o)-220(BT)7(d)-3( )-602(t)-5(h)6(e)9(fm -220

e

approximately 500,000 m^3, which allows for 50% sand bypassing. Posford et al. (1977) note W K D W L V S U R E D E O H W K D W W K H H Q W U D Q F H Z L O O U H P D L Q R S H Q Z L W K R X W F O R V L Q J W K H F D Q D O ¶

While existing monitoring suggests that the waterbody upstream of the entrance has a good ecological health, a permanent entrance is the only likely management option that would effectively increase circulation within the Shoalhaven Heads area. Previous research by Miller et al. (2006) suggests that the tidal flushing impact would be limited to the Shoalhaven Heads area, although this would depend on the entrance design. The primary beneficiary of this work would be the oys W H U K D U Y H V W D U H D V Z L W K L Q % H Q H I L W ¶ V P D \ E H O L P L W H G W R W K R V H L Q W K H Z D W H U E R G L H V X S V W U H D P R I W K H

6. Summary and Recommendations

This report details the previous studies, community feedback, identified concerns and

p

erosion/sediment transport. This recommendation aligns with HRC (1999) and the Estuary Management Plan (2008) recommendations.

- The Shoalhaven River flood study should be reviewed and updated to incorporate modern computational methods. Originally completed in 1990, the flood study for the region could be improved to address:
  - Refined entrance design levels, opening dynamics and dredging effects;
  - The role of Berry's Canal as the preferential flow path for floods in light of the expansion of the canal and the implications to discharge at the Shoalhaven Heads entrance;
  - Implications of Broughton Creek flooding levels and alternative triggers for localised floods;
  - Concerns with vegetation encroachment at the entrance and infilling dynamics of the bay;
  - Climate change implications.

- An educational program is recommended to highlight that the water quality within and around Shoalhaven Heads is of good quality, that circulation is sufficient, and that the estuary undergoes cyclical processes naturally opening and closing the entrance. The education campaign should also ensure that the community is prepared for future flood events, understand the broad acre acid sulphate soil concerns in the estuary and acknowledge the temporary nature of the shoals within the bay.

- Significant efforts should be made to address water quality issues affecting the oyster industry. Berry's Bay catchment appears to be recommended sources, undertake corrective measures and

0DQO\ +\GUDXOLFV /DERUDWRU\ ³6KRDOKDYHQ 5LYHU 6HSWHPEH
Report, Public Works, NSW Government, 1 page.

0DQO\ +\GUDXOLFV /DERUDWRU\ ³6KRDOKDYHQ 5LYHU ´7LGH SRUW
MHL562, November 1990, NSW Public Works, Sydney.

0DQO\ +\GUDXOLFV /DERUDWRU\ ³6KRDOKDYHQ 5LYHU 'UH 'LVSHUVL

Posford, Pavry, Sinclair and Knight (1977b), Engineering Studies of Shoalhaven - Crookhaven Estuary: Volume III, Shoalhaven Waterway Pla nning Study, for the Department of Public Works NSW, June.

3XEOLF :RUNV 'HSDUWPHQW 6KRDOKDYHQ +HDGV %HDFK 5HFHVVLR No. PWD 82023, August 1982, Civil Engineering Division, Public Works Department, NSW.

Public Works Depa

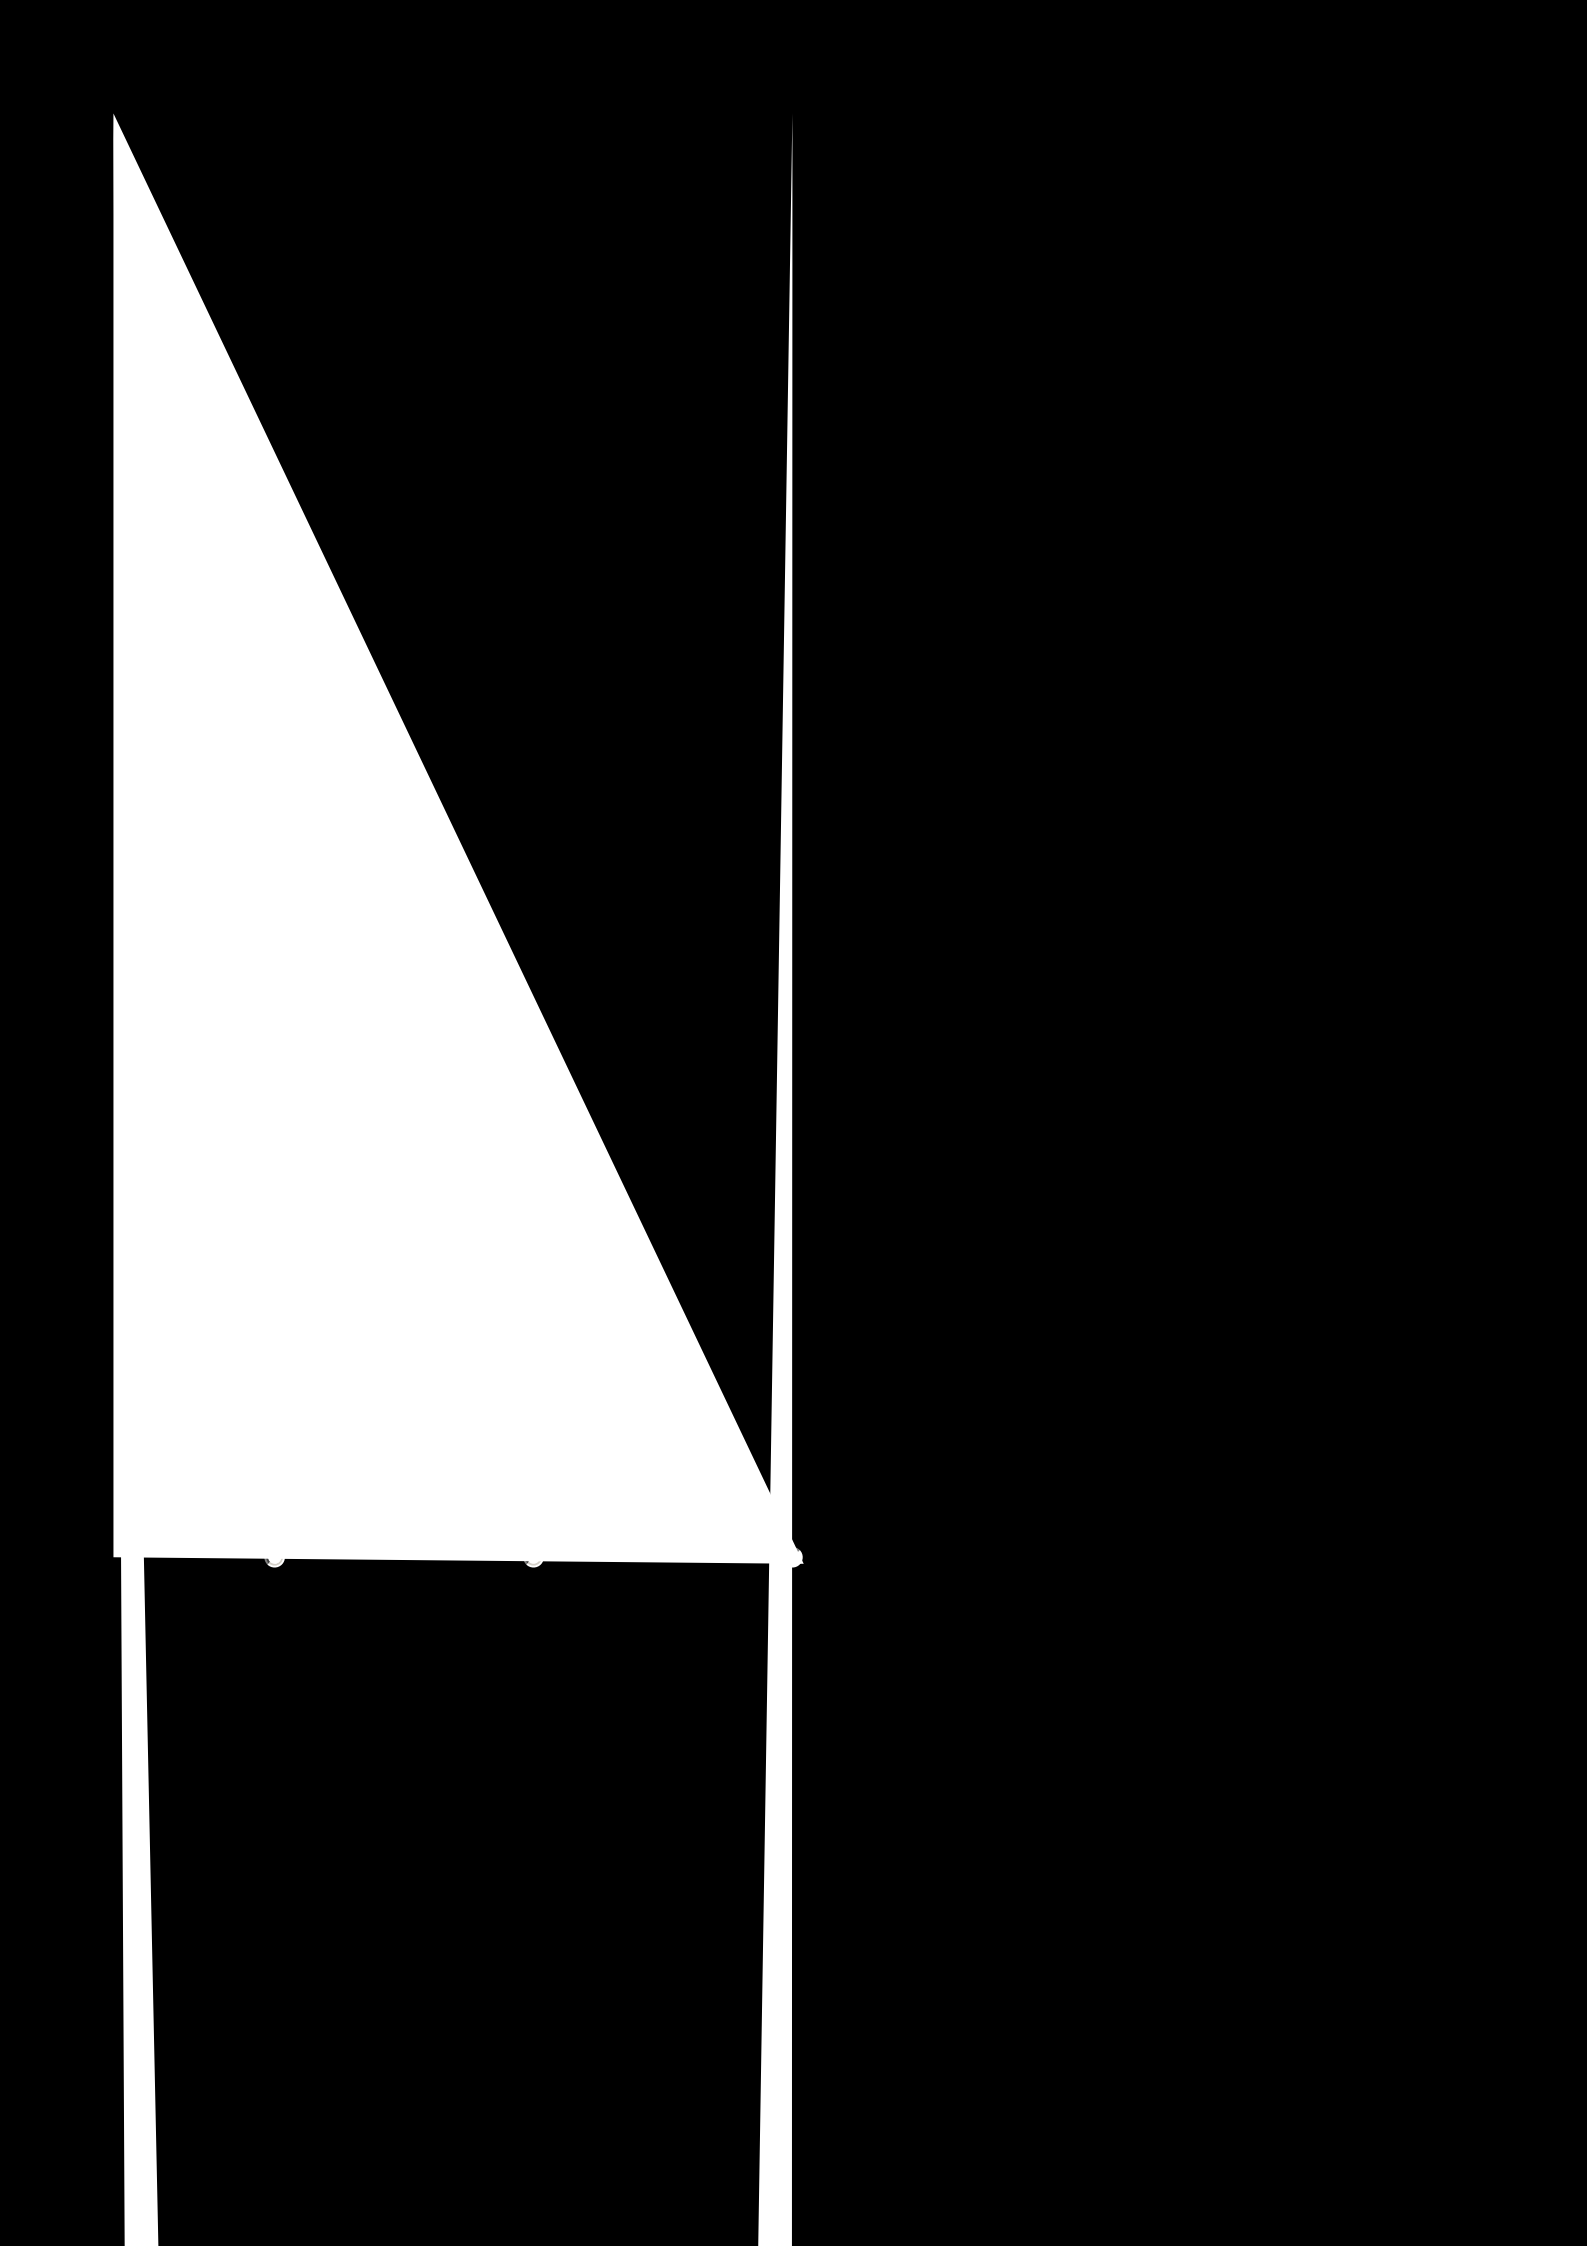

8. Rate your level of understanding on how the Shoalhaven River estuary flows to the sea?

Limited understanding	Moderate understanding	Strong understanding

9. How important is it for you to<u>maintain</u> the existing environment and amenity at Shoalhaven Heads estuary?

Limited importance	Somewhat important	Very important

10. How important is it to you to<u>improve</u> the amenity and recreational values of the Shoalhaven Heads estuary?

Limited importance	Somewhat important	Very important

Other (please specify any improvements)

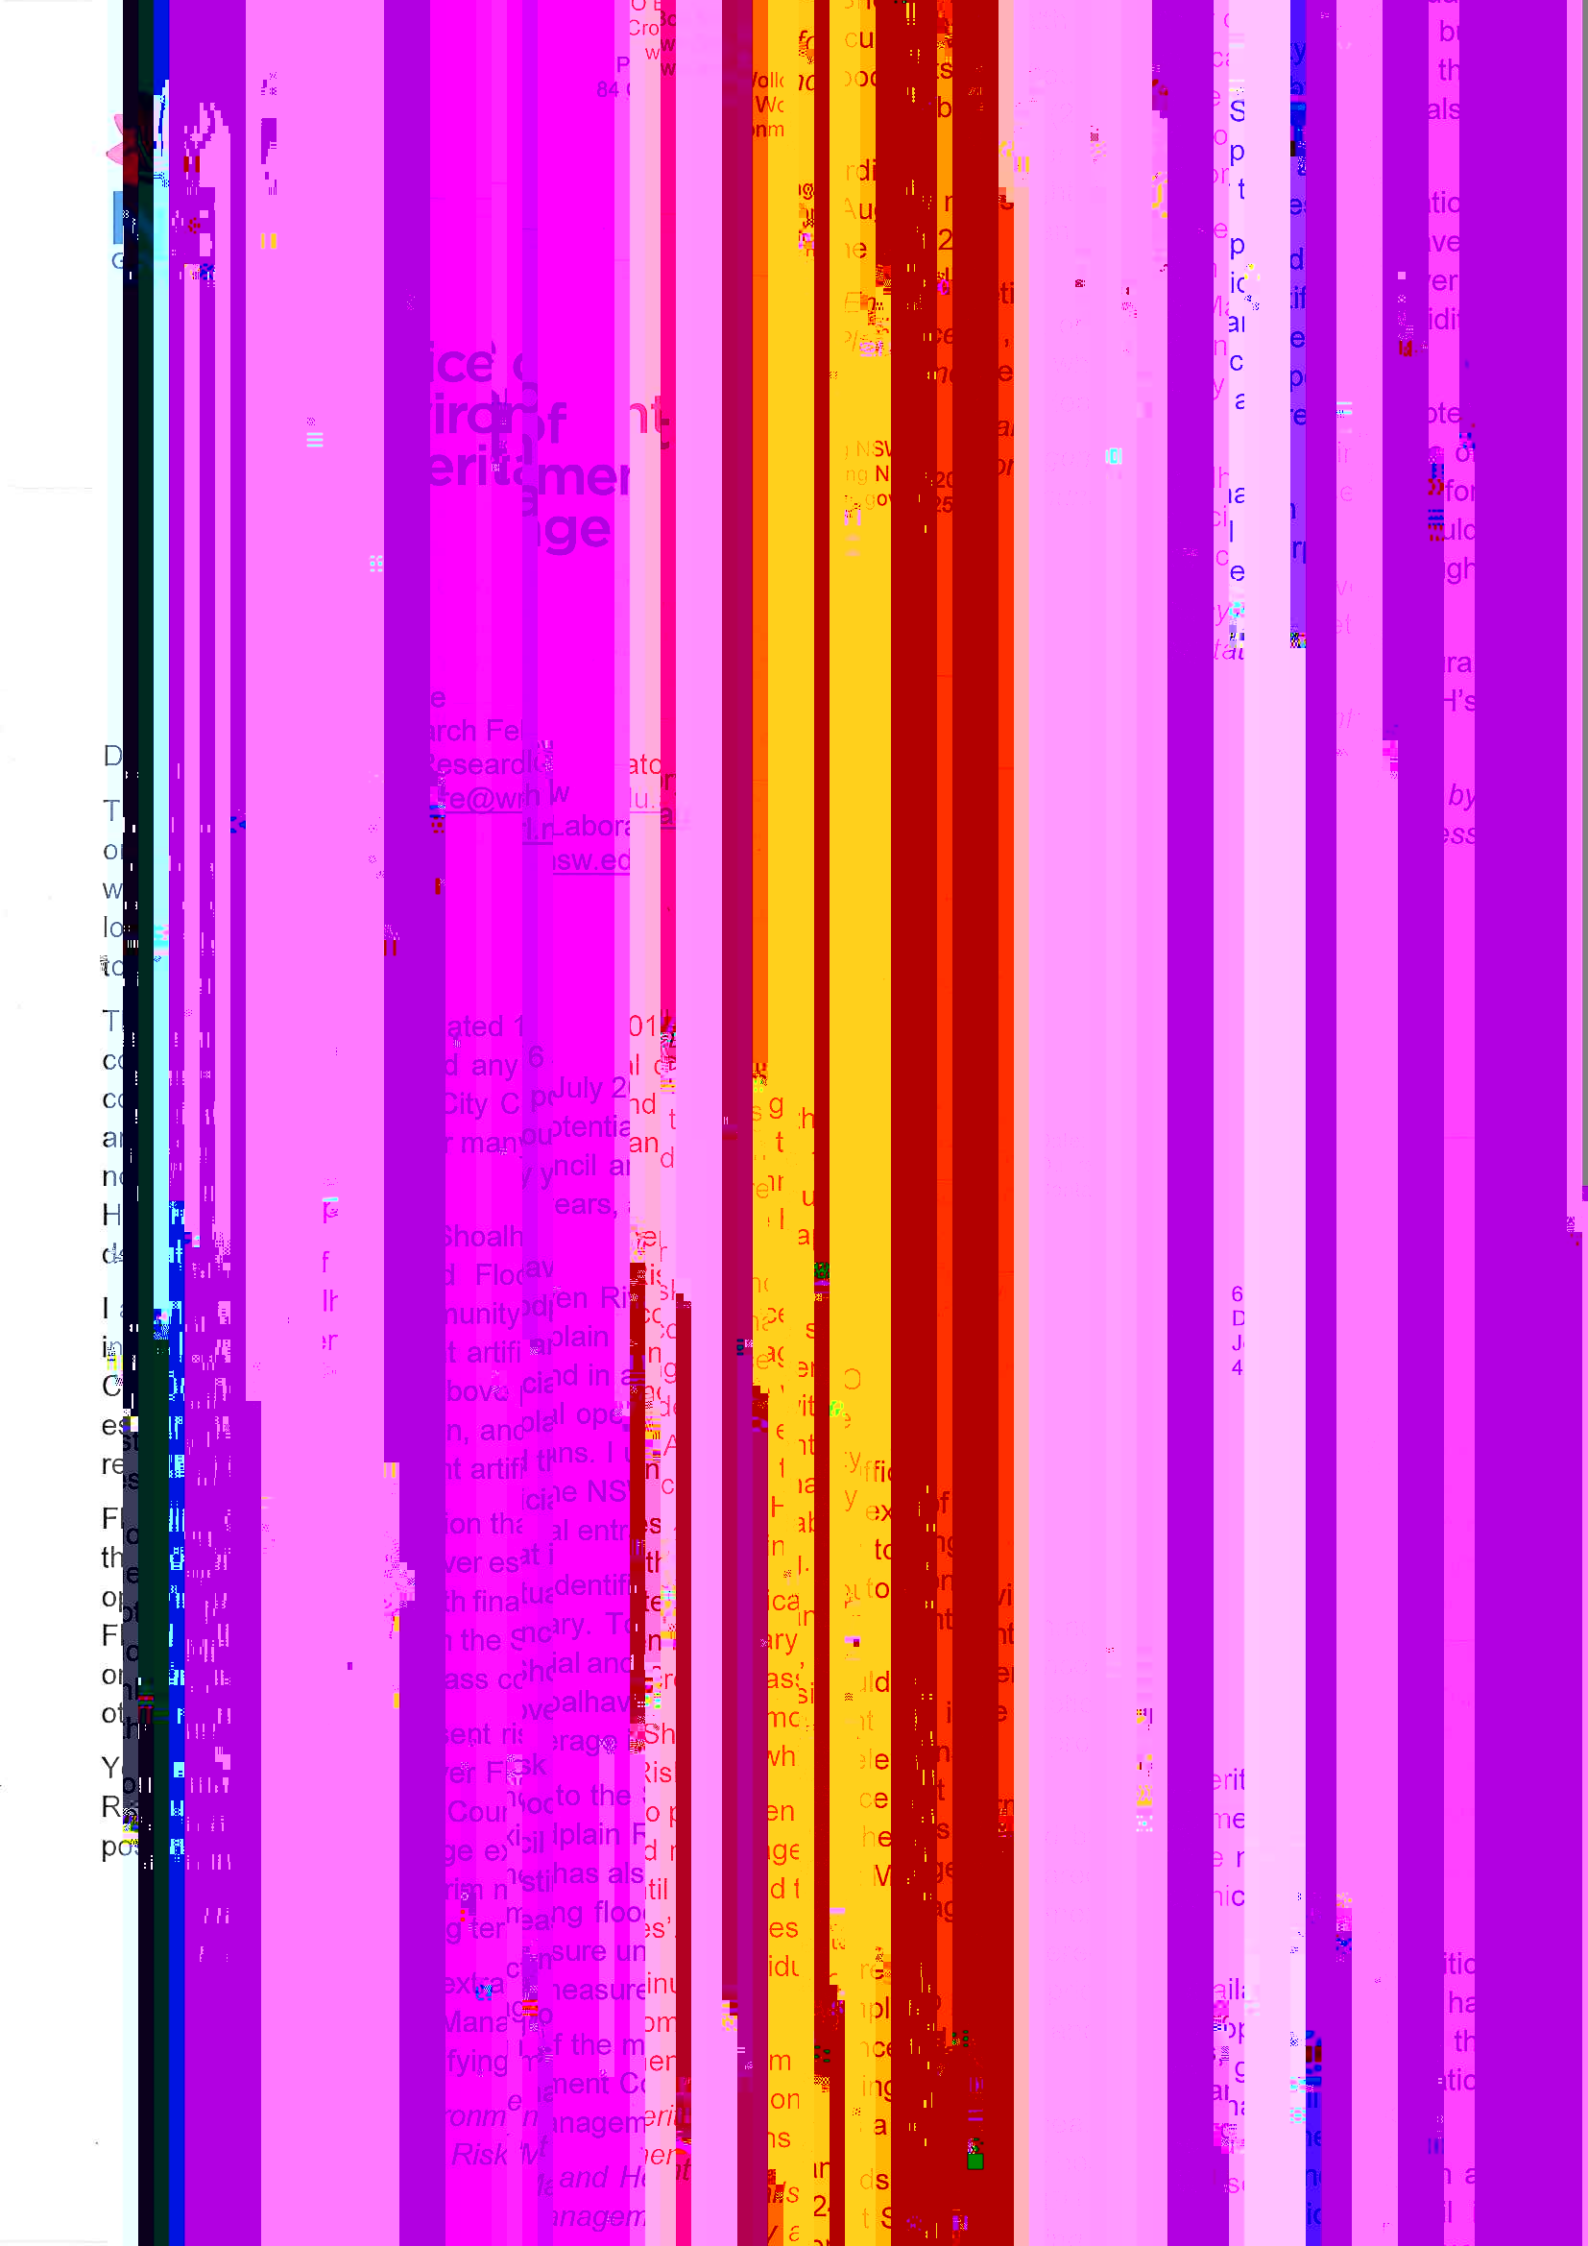

In re
mar
proc
repre
from

The
and B
estuar
Team
john.b

Yours

Gabri
Regio

Water Research Laboratory

Memorandum

To: Ms. Isabelle Ghetti
Date: Wednesday 23rd March 2016
From: Will Glamore
Ref: WRL Memo 20160323_v2.doc
Subject: Desktop Analysis of Various Options for the Channel on the North Side of Old Man Island in the Shoalhaven River Estuary.

Introduction

The Water Research Laboratory (WRL) of the School of Civil and Environmental Engineering at UNSW Australia has recently completed an investigation entitled, Management Options for Improving Flows of the Shoalhaven River at Shoalhaven Heads (WRL Technical Report 2015/19). Numerical modelling was undertaken as part of the study to investigate management options that may increase water circulation in the estuary at Shoalhaven Heads and prevent the area becoming a shoaled backwater. Subsequent to the findings of the study, The Shoalhaven Heads Estuary Taskforce, an advisory committee of Shoalhaven City Council (SCC), requested additional desktop analysis of management options for the channel on the north side of Old Man Island in the Shoalhaven River estuary, to further investigate the potential for improving flows at Shoalhaven Heads. The options proposed for investigation included:

1. Shoalhaven Heads entrance opened and existing conditions in the channel on the north side of Old Man Island;
2. Shoalhaven Heads entrance opened and the channel on the north side of Old Man Island dredged to -2.0 m AHD, with the existing channel width maintained (approximately 80 m); and
3. Shoalhaven Heads entrance opened, the channel on the north side of Old Man Island dredged to -5.0 m AHD and widened to approximately twice the width of the existing channel.

Numerical simulations were undertaken using a calibrated, 2-Dimensional hydrodynamic computer model of the lower Shoalhaven River estuary to assess the implications of the options proposed. The model was used to simulate changes to hydrodynamic conditions based on the proposed options, including water levels, velocities, and tidal flushing dynamics. A summary of the model scenarios is provided in Table 1. The ocean boundary salinity was set to 35.0 ppt, and ocean boundary water levels were selected from a representative year of tidal record at Crookhaven Heads. It is worth noting that the options proposed were investigated without considering wave action and sediment dynamics at the ocean entrances, which would be likely to have other significant impacts.

Table 1. Model Scenarios

Scenario	Management Option for Shoalhaven Heads Entrance	Management Option for Northern Channel

Water level, velocity, discharge, and salinity data was extracted at several locations of interest in the Shoalhaven River estuary, including the Northern Channel (i.e. W K H F K D Q Q H O R Q W K H Q R U W K V L G H R I 2 O G 0 D Q , V O Heads, and the River Road Reserve Boat Ramp, and Crookhaven Heads, as shown in Figure 1.

Predicted Salinity Concentrations

Predictions of annual salinity concentrations at these locations, including the median, minimum, maximum, and 10th percentile and 90th percentile values, are provided in Figure 2. Analysis of the results from the numerical simulations of the proposed options has shown that there is no significant statistical difference in salinity concentrations at the locations of interest in the Shoalhaven River estuary. In particular, comparing the results from Cases D Q G D W % H U U \ ¶ V showed that there was limited increase in annual median salinity concentrations at Shoalhaven Heads (<1% increase) as a result of dredging the channel on the north side of Old Man Island. It is worth noting that for an open entrance at Shoalhaven Heads (Cases 1

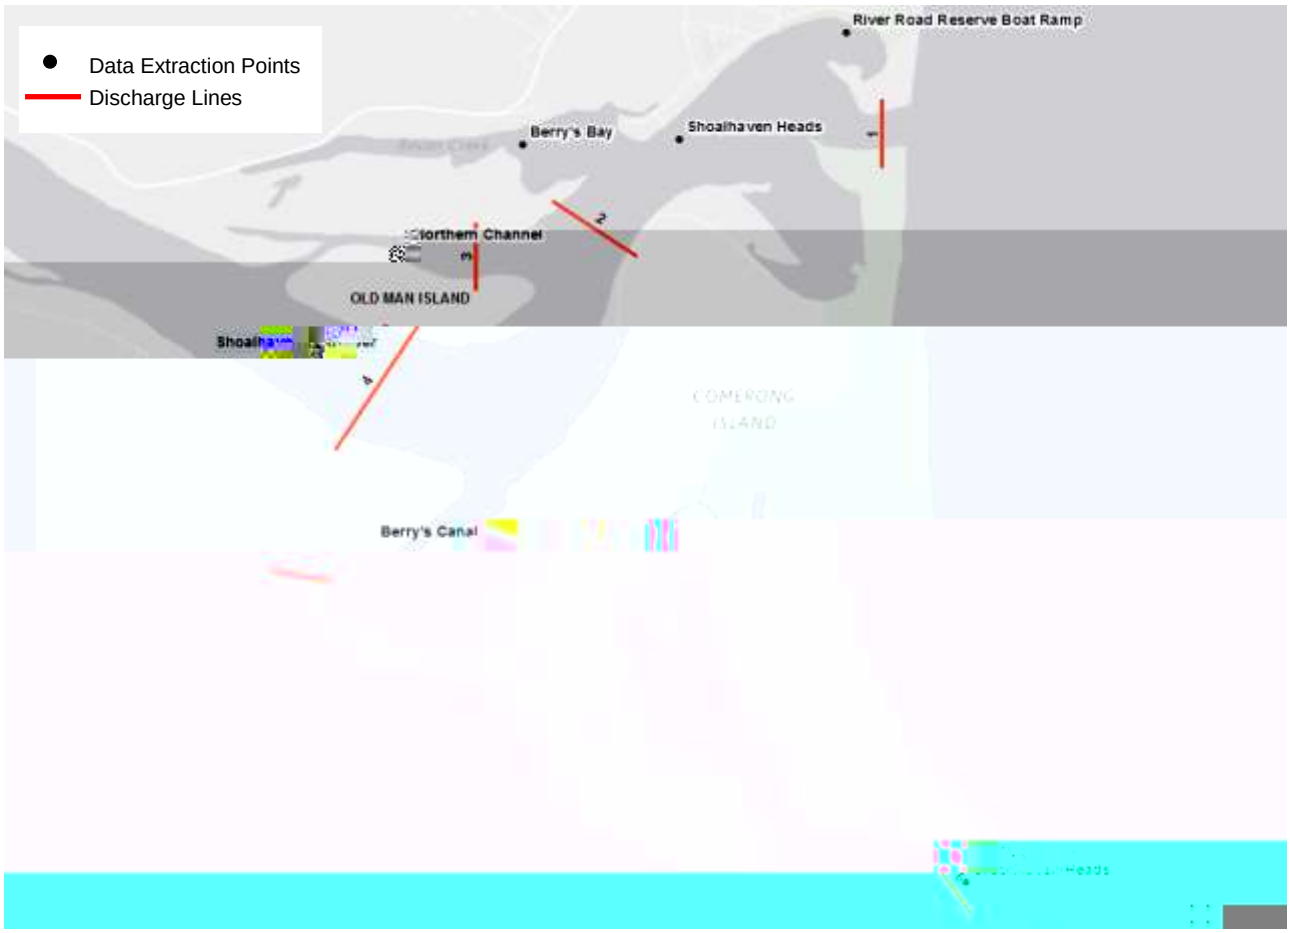

Figure 1. Location Figure Showing Data Extraction Points

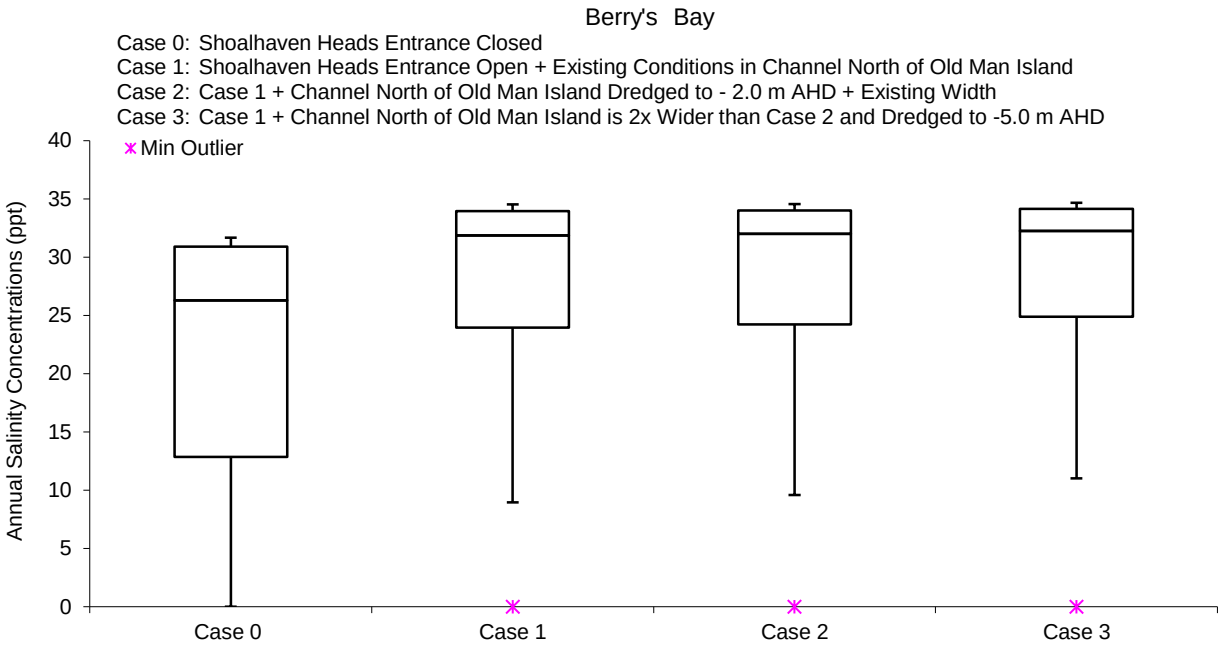

Figure 3. Statistical Analysis (Minimum, Maximum, Median, 10 th Percentile, 90 th Percentile) of Predicted Annual Salinity &RQFHQWUDWLRQV DW %HUU\¶V %D\ LQ WKH 6KRDOKDYHQ 5LYHU (VWXDU\ IRU WKH 2S Shoalhaven Heads Entrance